# **HOME REPORT**

FLAT 1 5 CROWN CRESCENT LARBERT FK5 4XP



# ENERGY PERFORMANCE CERTIFICATE





## **Energy Performance Certificate (EPC)**

# Scotland

Dwellings

#### FLAT 1, 5 CROWN CRESCENT, LARBERT, FK5 4XP

Dwelling type:	Ground-floor flat
Date of assessment:	09 April 2024
Date of certificate:	10 April 2024
Total floor area:	72 m <sup>2</sup>
Primary Energy Indicator:	138 kWh/m <sup>2</sup> /year

Reference number: Type of assessment: Approved Organisation: Main heating and fuel: 9114-9024-6430-2941-8206 RdSAP, existing dwelling Elmhurst Boiler and radiators, mains gas


#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home


Estimated energy costs for your home for 3 years*	£2,355	See your recommendations
Over 3 years you could save*	£135	report for more information

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Current

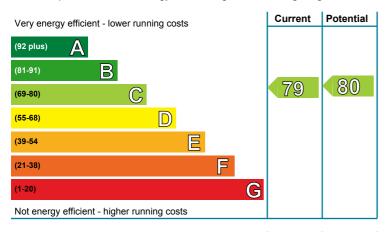

Very environmentally friendly - lower CO<sub>2</sub> emissions

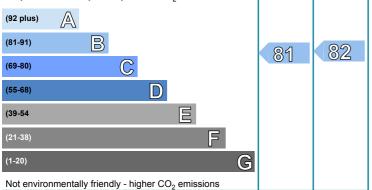

#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (79)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (81)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Top actions you can take to save money and make your home more efficient

Potential

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (solid floor)	£4,000 - £6,000	£135.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282. THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

#### FLAT 1 , 5 CROWN CRESCENT, LARBERT, FK5 4XP 10 April 2024 RRN: 9114-9024-6430-2941-8206

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	(another dwelling above)	—	
Floor	Solid, limited insulation (assumed)	—	
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	
Hot water	From main system	<b>★★★</b> ☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	****	*****

#### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

#### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 24 kg  $CO_2/m^2/yr$ .

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.7 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

#### FLAT 1, 5 CROWN CRESCENT, LARBERT, FK5 4XP 10 April 2024 RRN: 9114-9024-6430-2941-8206

Estimated energy of	osts for this home		
	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,488 over 3 years	£1,350 over 3 years	
Hot water	£546 over 3 years	£549 over 3 years	You could
Lighting	£321 over 3 years	£321 over 3 years	save £135
Total	s £2,355	£2,220	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Decembra de dimensiones	Indiantics and	Typical saving	Rating after improvement	
Recommended measures	Indicative cost	per year	Energy	Environment
1 Floor insulation (solid floor)	£4,000 - £6,000	£45	C 80	B 82

#### Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

energy

#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

#### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	4,010	N/A	N/A	N/A
Water heating (kWh per year)	2,028			

#### FLAT 1 , 5 CROWN CRESCENT, LARBERT, FK5 4XP <u>10 April 2024</u> RRN: 9114-9024-6430-2941-8206

#### About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mrs. Tracy Hutchinson
Assessor membership number:	EES/027914
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	Unit 6A The Courtyard Callendar Business Park Falkirk FK1 1XR
Phone number:	01383621262
Email address:	tracy.hutchison@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### FLAT 1 , 5 CROWN CRESCENT, LARBERT, FK5 4XP 10 April 2024 RRN: 9114-9024-6430-2941-8206

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.





# SINGLE SURVEY





### survey report on:

Property address	FLAT 1, 5 CROWN CRESCENT, LARBERT, FK5 4XP
------------------	---

Customer Aitkenhead
---------------------

Customer address	

Prepared by	DM Hall LLP

Date of inspection	9th April 2024
--------------------	----------------



### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

### **PART 2 - DESCRIPTION OF THE REPORT**

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

### Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The property comprises a purpose built ground floor flat in a three storey block of nine units.
Accommodation	Ground: Hallway, Living and Dining Room, Kitchen, Main Bedroom with en-suite Shower Room, Second Double Bedroom and Bathroom.

Gross internal floor area (m²)	72 sqm or thereby

Neighbourhood and location	The property forms part of an established residential area in the
	town of Larbert, Falkirk. The surrounding properties in the
	immediate vicinity are generally of a similar age and style. A range
	of typical local amenities can be found nearby.

Age	29 years.
Weather	It was overcast with rain showers, following generally similar
	conditions.

Chimney stacks	There are no chimney stacks.
----------------	------------------------------

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	The roof is of a pitched design, overlaid with concrete tiles having ridges and hips formed in tile. Valleys are lined with metal materials.
	The property is a ground floor flat with another dwelling above and no access was available to the roof space.

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. There are half round UPVC gutters in place, which connect to round UPVC downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The block is of timber frame construction with a block outer leaf having a rendered and pointed synthetic stone external finish and a wall thickness of approximately 300 mm thick.
	I would make the reasonable assumption that a suitable damp proof course was installed in the property at the time of construction, in line with regulations in place at the time.

Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows: Double glazed UPVC framed windows units are installed.
	Doors: The access door off the communal hallway is of timber panelled design.
	The soffits and fascias are formed in UPVC.

External decorations	There is no requirement for external redecoration of UPVC joinery finishes.

Conservatories / porches	There are no conservatories / porches.
Communal areas	Circulation areas visually inspected.
	Access to the property is via a shared hallway and stairwell. Secure entry doors are in place.
	There is a communal carpark.

Garages and permanent outbuildings	Visually inspected.
	Shared communal bin stores

Outside areas and boundaries	Visually inspected.
	The block has shared garden areas and car parking. The garden areas are surfaced in grass, planting and shrubbery. The car park is surfaced in mono block paving.
Ceilings	Visually inspected from floor level.

	The ceilings are of plasterboard.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls and partitions are of plasterboard construction.

Floors including sub floors	The ground floor is of solid construction.
Ŭ	

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal doors consist of timber panel style.
	The facings and skirtings are of flush style.
	The kitchen is fitted with a range of base and wall mounted units having compatible worktops and integrated appliances and a stainless steel sink unit and side drainer.

Chimney breasts and fireplaces	There are no chimney breasts/fireplaces.
Internal decorations	Visually inspected.
	The internal walls and ceilings mostly have a painted finish.
	The internal joinery is finished in paint and varnish.

Cellars	There are no cellars.

Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Main supply installed.
	The electricity consumer unit and meter are located in the hallway cupboard.

Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply installed.
	The gas meter is located in an external box to the front of the property.


Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Water is connected to the mains.
	All visible pipework is made with copper and PVC materials.
	The bathroom is fitted with a white suite containing a WC, wash hand basin and bath with hand shower.
	The ensuite shower room is fitted with a white suite containg a WC, wash hand basin and shower cubicle with electric shower over.

Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	A wall mounted gas fired Potterton Promax Combi HE Plus boiler within a kitchen cupboard supplies a radiator heating system. This also supplies the domestic hot water.

Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage is connected to the mains sewer.

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	There are smoke alarms installed in the property.
	Legislation by the Scottish Government, which took effect from February 2022, requires residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

Any additional limits to inspection         For flats / maisonettes           Only the subject flat and internal communal areas giving access to the flat were inspected.         If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, the will be stated. If no inspection was possible, their will be stated. If no inspection was possible, their will be stated. If no inspection was possible, their will be stated. If no inspection was possible, their will be stated. If no inspection was possible, their will be stated. If no inspection or defects that will have a material effect on the valuation.           The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.           The property was vacant, and all floors were covered. Floor coverings restricted my inspection of flooring.           Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.           I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation have assumed that there is no Japanese Knotweed and unless otherwise stated, for the purposes of the valuation in have assumed that there is no Japanese Knotweed and unless otherwise stated, for the purpose or other invasive plants within the boundaries of the property or in neighbouring properties.           The report does not include an asbestos inspection. However asbestos was widely used in the building industry unit around a state access based products has been reported within the inmations of the inspectin for darpness was undertaken internally with the		
access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. The property was vacant, and all floors were covered. Floor coverings restricted my inspection of flooring. Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect. I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation. I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties. The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a baned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concens you should engage a qualified asbestos surveyor. Random testing for dampness was undetaken internally with the use of a moisture meter where accessible and considered appropriate. The property is a ground floor flat with another dwelling above and no access was available to the roof space. Concealed areas beneath and around bath and shower tray areas were not visible. The property is a ground floor flat with another dwelling above and no access was available to the roof space. Concealed areas beneath and around bath and shower tray areas were not visible. The inspection is not a fire or lie safety risk assessment and should not be relied on as a risk asasessment and should not be relied on as a risk assessment and	Any additional limits to inspection	For flats / maisonettes
reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. The property was vacant, and all floors were covered. Floor coverings restricted my inspection of flooring. Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect. I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property with around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate. In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects, particularly in cupboards. Floor covering have not been moved. My inspection of the roof covering was restricted from ground level and some parts were not visible. The property is a ground floor flat with another dwelling above and no access was available to the roof space. Concealed areas beneath and around bath and shower tray areas were not visible. Water spillage in these areas can often be discovered unexpected with resultant damage to concealed parts of the fabric. The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment of the property and building thist forms part of is required. Where repairs are r		
communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.         The property was vacant, and all floors were covered. Floor coverings restricted my inspection of flooring.         Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.         I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.         The report does not include an asbestos inspection. However asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.         Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.         In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects, particularly in cupboards. Floor covering was restricted from ground level and some parts were not visible.         The property is a ground floor flat with another dwelling above and no access was available to the roof space.         The property is no ta fire or life safety risk assessment and should not be relied on as a risk assessment and should not be relied on as a risk assessment and should not be relied on as a risk assessment of the property and building that it forms part of the reaprime.		reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no
coverings restricted my inspection of flooring.         Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.         I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed and the sasumed that there is no Japanese Knotweed and the sasumed that there is no Japanese Knotweed and the sasumed that there is no Japanese Knotweed and the sasumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.         The report does not include an asbestos inspection. However asbeetso was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.         Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.         In accordance with Health and Safety guidelines I have not disturbed insulation, fumiture or personal effects, particularly in cupboards. Floor covering have not been moved.         My inspection of the roof covering was restricted from ground level and some parts were not visible.         The report is a ground floor flat with another dwelling above and no access was available to the roof space.         Concealed areas beneath and around bath and shower tray areas were not visible.         The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice shoul		communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general
<ul> <li>inaccessible, cannot be guaranteed to be free from defect.</li> <li>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</li> <li>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</li> <li>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</li> <li>In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects, particularly in cupboards. Floor covering was restricted from ground level and some parts were not visible.</li> <li>The property is a ground floor flat with another dwelling above and no access was available to the roof space.</li> <li>Concealed areas beneath and around bath and shower tray areas were not visible.</li> <li>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should hot be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property legislation of the rord part. Pricing repairs is out with the romit of this report to its root of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider casts and budgeting before offering. The various trades can advise</li> </ul>		
unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects, particularly in cupboards. Floor coverings have not been moved.My inspection of the roof covering was restricted from ground level and some parts were not visible.The property is a ground floor flat with another dwelling above and no access was available to the roof space.Concealed areas beneath and around bath and shower tray areas were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of require. The various trades can advise		
<ul> <li>asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</li> <li>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</li> <li>In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects, particularly in cupboards. Floor coverings have not been moved.</li> <li>My inspection of the roof covering was restricted from ground level and some parts were not visible.</li> <li>The property is a ground floor flat with another dwelling above and no access was available to the roof space.</li> <li>Concealed areas beneath and around bath and shower tray areas were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</li> <li>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</li> <li>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of repair. Pricing repairs is out with the remit of this report built it would be prudent to consider costs and building before offering. The various trades can advise</li> </ul>		unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring
<ul> <li>use of a moisture meter where accessible and considered appropriate.</li> <li>In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects, particularly in cupboards. Floor coverings have not been moved.</li> <li>My inspection of the roof covering was restricted from ground level and some parts were not visible.</li> <li>The property is a ground floor flat with another dwelling above and no access was available to the roof space.</li> <li>Concealed areas beneath and around bath and shower tray areas were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</li> <li>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</li> <li>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise</li> </ul>		asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a
disturbed insulation, furniture or personal effects, particularly in cupboards. Floor coverings have not been moved. My inspection of the roof covering was restricted from ground level and some parts were not visible. The property is a ground floor flat with another dwelling above and no access was available to the roof space. Concealed areas beneath and around bath and shower tray areas were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric. The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required. Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise		use of a moisture meter where accessible and considered
<ul> <li>and some parts were not visible.</li> <li>The property is a ground floor flat with another dwelling above and no access was available to the roof space.</li> <li>Concealed areas beneath and around bath and shower tray areas were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</li> <li>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</li> <li>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise</li> </ul>		disturbed insulation, furniture or personal effects, particularly in
<ul> <li>no access was available to the roof space.</li> <li>Concealed areas beneath and around bath and shower tray areas were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</li> <li>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</li> <li>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise</li> </ul>		
<ul> <li>were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</li> <li>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</li> <li>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise</li> </ul>		
should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required. Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise		were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts
Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise		should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the
		Safety legislation often requires the use of scaffolding which can significantlyimpact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise

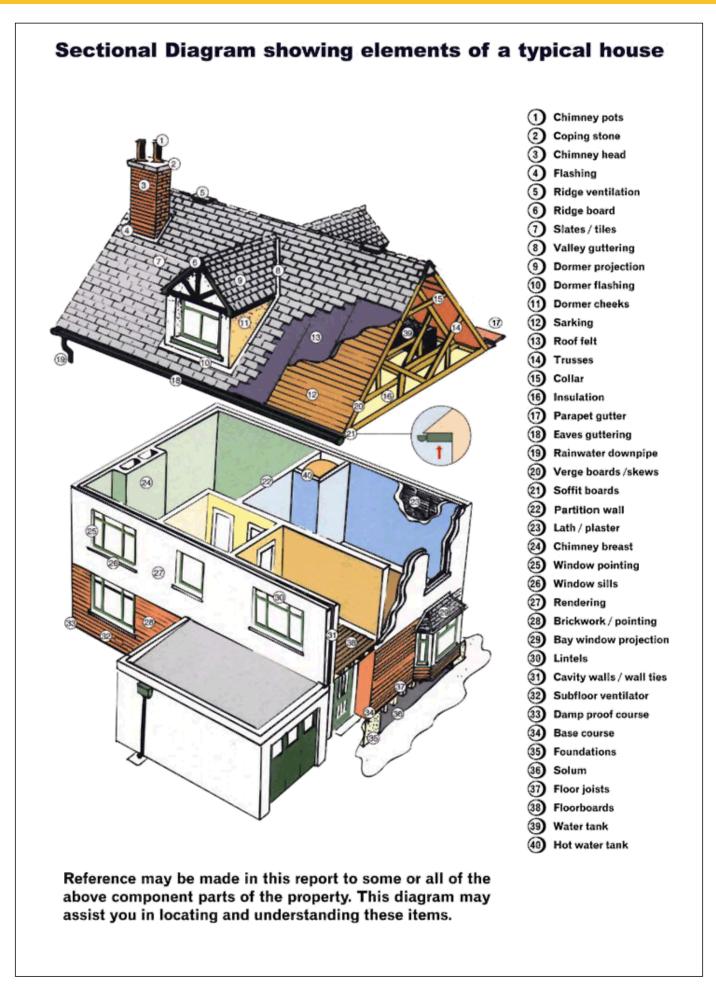

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category	1
Notes	No obvious evidence of significant dampness, rot or wood boring insect infestation.

Chimney stacks	
Repair category	-
Notes	Not Applicable.

Roofing including roof space	
Repair category	1
Notes	Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair or replacement costs.

Rainwater fittings	
Repair category	1
Notes	No significant defects evident.

Main walls	
Repair category	1
Notes	No significant defects evident.

Windows, external doors and joinery	
Repair category	1
Notes	No significant defects evident.

External decorations	
Repair category	1
Notes	No significant defects evident.

Conservatories/porches	
Repair category	-
Notes	Not Applicable.

Communal areas	
Repair category	1
Notes	No significant defects evident.

Garages and permanent outbuildings	
Repair category	1
Notes	No significant defects evident.

Outside areas and boundaries	
Repair category	1
Notes	No significant defects evident.

Ceilings	
Repair category	1
Notes	No significant defects evident.

Internal walls	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	1
Notes	No significant defects evident.

Internal joinery and kitchen fittings	
Repair category	1
Notes	No significant defects evident.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not Applicable.

Internal decorations	
Repair category	1
Notes	No significant defects evident.

Cellars	
Repair category	-
Notes	Not Applicable.

Electricity	
Repair category	1
Notes	I am informed an EICR is in place. All relating documentation should be retained. It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.

Gas	
Repair category	1
Notes	I am informed a gas safety certificate is in place. All relating documentation should be retained.

<b>F</b> Water, plumbing and bathroom fittings	
Repair category	1
Notes	No significant defects evident.

Heating and hot water				
Repair category	1			
Notes	I am informed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.			
	Boilers and central heating systems should be tested and serviced by a Gas Saferegistered engineer on an annual basis to ensure their safe and efficient			

Heating and hot wat	er
Repair category	1
Notes	operation. The central heating boiler is of an older design. Informed opinion suggests that boilers have a life expectancy between 10 and 20 years depending on the quality of the boiler and whether or not regular maintenance has been carried out. Future repair or replacement should be anticipated.

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

#### **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

#### Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor	
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No	
3. Is there a lift to the main entrance door of the property?	Yes No X	
4. Are all door openings greater than 750mm?	Yes X No	
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No	
6. Is there a toilet on the same level as a bedroom?	Yes X No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No	
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No	

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

The subjects form part of a tenement and it has been assumed that maintenance and repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

It is understood there are factoring arrangements in place in respect of the maintenance and upkeep of communal areas. This should be verified by the completing conveyancer.

#### Estimated reinstatement cost for insurance purposes

£190,000 (One hundred and ninety thousand pounds).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

#### Valuation and market comments

The market value for the property in its current condition would be fairly stated at £175,000.

Against a backdrop of changing economic circumstances and increasing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

Signed	Security Print Code [464517 = 8648 ]O		
	Electronically signed		

Report author	Tracy Hutchison

Company name     DM Hall LLP	
------------------------------	--

Address	Unit 6A, The Courtyard, Callendar Business Park, Falkirk, FK1 1XR
---------	---

Date of report	17th April 2024

## Mortgage Valuation Report



Property Address	
Address Seller's Name Date of Inspection	FLAT 1, 5 CROWN CRESCENT, LARBERT, FK5 4XP Aitkenhead 9th April 2024
Property Details	
Property Type	House       Bungalow       Chalet       Purpose built maisonette         Coach       Studio       Converted maisonette       Purpose built flat         Converted flat       X Tenement flat       Flat over non-residential use       Other (specify in General Remarks)
Property Style	Detached       Semi detached       Mid terrace       End terrace         Back to back       High rise block       X Low rise block       Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector,
Flats/Maisonettes onl	y Floor(s) on which located 0 No. of floors in block 3 Lift provided? Yes X No No. of units in block 9
Approximate Year of	Construction 1995
Tenure	
X Absolute Ownership	Leasehold     Ground rent £     Unexpired years
Accommodation	
Number of Rooms	1       Living room(s)       2       Bedroom(s)       1       Kitchen(s)         2       Bathroom(s)       0       WC(s)       0       Other (Specify in General remarks)
Gross Floor Area (exc	cluding garages and outbuildings) 72 m <sup>2</sup> (Internal) 82 m <sup>2</sup> (External)
Residential Element (	greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site?	Double garage       X Parking space       No garage / garage space / parking space         X Yes       No
Permanent outbuildin	gs:
No permanent outbu	uildings.

## Mortgage Valuation Report

Construction							
Walls Roof	Brick	Stone Cavity	Concrete	X Timber frame X Concrete block	Other	(specify in Gen	eral Remarks)
			Artificial sla		Other	(specify in Gen	eral Remarks)
Special Risks							
Has the property s	suffered struct	ural moveme	ent?			Yes	X No
If Yes, is this rece	nt or progress	ive?				Yes	No
Is there evidence, immediate vicinity		ason to antic	ipate subsidence,	heave, landslip c	or flood in the	Yes	X No
If Yes to any of the	e above, prov	ide details in	General Remark	S.			
Service Connec	tion						
Based on visual ir of the supply in G			ces appear to be	non-mains, please	e comment or	n the type ar	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Heating fuel: Ga Heating type: Ra							
Site							
Apparent legal iss	ues to be veri	fied by the c	onvevancer. Plea	se provide a brief	description in	n General Re	emarks.
Rights of way	X Shared driv	•	-	amenities on separate	· _	ed service conn	
Agricultural land in	cluded with prope	erty	Ill-defined bound	aries	Other	(specify in Ge	neral Remarks)
Location							
X Residential suburb	Res	idential within to	own / city 📃 Mixe	d residential / commer	cial 🗌 Mainly	y commercial	
Commuter village	Rer	note village	Isola	ted rural property	Other	(specify in Ge	neral Remarks)
Planning Issues	5						
Has the property b	been extended	d / converted	l / altered?	res X No			
If Yes provide details in General Remarks.							
Roads							
X Made up road	Unmade road	d Partly	completed new road	Pedestrian a	ccess only	X Adopted	Unadopted

## Mortgage Valuation Report

#### **General Remarks**

The property forms part of an established residential area in the town of Larbert, Falkirk. The surrounding properties in the immediate vicinity are generally of a similar age. A range of typical local amenities can be found nearby.

The property appears in a condition consistent with age and type.

#### **Essential Repairs**

None required for mortgage purposes.

Estimated cost of essential repairs £

Retention recommended? Yes

X No Amount £

#### Mortgage Valuation Report

#### **Comment on Mortgageability**

Subject to individual lending requirements, we would confirm that the property forms suitable se mortgage loan purposes.	curity for normal
Valuations	
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VA Is a reinspection necessary?	£ 175,000 £ £ 190,000 T) Yes X No
Buy To Let Cases	
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? Is the property in an area where there is a steady demand for rented accommodation of this type?	
Declaration	
Signad Security Print Code [464517 - 9649]0	

Signed	Security Print Code [464517 = 8648 ]O Electronically signed by:-
Surveyor's name	Tracy Hutchison
Professional qualifications	AssocRICS
Company name	DM Hall LLP
Address	Unit 6A, The Courtyard, Callendar Business Park, Falkirk, FK1 1XR
Telephone	01324 628321
Fax	01324 612147
Report date	17th April 2024

# **PROPERTY QUESTIONNAIRE**





Property address	AT 1,
5 Cl	ROWN CRESCENT,
LAF	RBERT,
FK5	5 4XP

Seller(s)	Lesley Aitkenhead
-----------	-------------------

Completion date of property questionnaire	9 April 2024
---	--------------

#### Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

#### Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? March 2020
2.	Council tax
	Which Council Tax band is your property in? (Please circle) A B C D E F G H
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	• Garage
	Allocated parking space
	• Driveway
	● Shared parking ✓
	On street
	Resident permit
	Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<del>Yes</del> / No
6.	Alterations/additions/extensions	
a.	<ul> <li>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</li> <li><u>If you have answered yes</u>, please describe below the changes which you have made:</li> </ul>	<del>Yes</del> / No
	<ul> <li>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</li> <li><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</li> <li>If you do not have the documents yourself, please note below who has these documents and your solicitor as a possible for the purchaser.</li> </ul>	<del>Yes</del> / <del>Ne</del>
b.	documents and your solicitor or estate agent will arrange to obtain them: Have you had replacement windows, doors, patio doors or double glazing installed in your property?	<del>Yes</del> / No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<del>Yes</del> / <del>No</del>
	(ii) Did this work involve any changes to the window or door openings?	<del>Yes</del> / <del>No</del>
	(iii) Please describe the changes made to the windows, doors or patio doors (w dates when the work was completed):	vith approximate
	Please give any guarantees which you received for this work to your solicitor or e	state agent.

7.	Central heating		
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	Yes / <del>No</del> / Partial	
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).		
	Gas fired		
	If you have answered yes, please answer the three questions below:		
b.	When was your central heating system or partial central heating system installed?	2015	
c.	Do you have a maintenance contract for the central heating system?	<del>Yes</del> / No	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
d.	When was your maintenance agreement last renewed? (Please provide the month and year).		
8.	Energy Performance Certificate		
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / <del>No</del>	
9.	Issues that may have affected your property		
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<del>Yes</del> / No	
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<del>Yes</del> / No	
b.	Are you aware of the existence of asbestos in your property?	<del>¥es</del> / No	
	If you have answered yes, please give details:		

0.	Services				
a.	Please tick which services are connected to your property and give details of the supplier:				
	Services	Connected	Supplier		
	Gas / liquid petroleum gas	✓	British Gas		
	Water mains / private water supply	~	Scottish Water		
	Electricity	$\checkmark$	British Gas		
	Mains drainage	~	Scottish Water		
	Telephone	✓	вт		
	Cable TV / satellite	Cable TV / satellite          Virgin Media			
	Broadband	$\checkmark$	Virgin Media		
).	Is there a septic tank system at yo			<del>Yes</del> / No	
	If you have answered yes, please	answer the two	questions below:		
	(i) Do you have appropriate conse	ents for the discl	narge from your septic tank?	<del>Yes</del> / <del>No</del> / Den't know	
I.	(ii) Do you have a maintenance co	ontract for your s	septic tank?	<del>Yes</del> / <del>No</del>	
	If you have answered yes, please have a maintenance contract:	e give details of	the company with which you		

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	Yes / <del>No</del> / Don't Know
	If you have answered yes, please give details:	
	Stared Stair is covered by management services of Hacking & Paterson, with all flats paying a shared cost. Shared garden is covered by contract with Green Belt for maintenance.	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	Yes / <del>No</del> / <del>Not applicable</del>
	If you have answered yes, please give details:	
	Included in H&P Managed service.	
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<del>¥es</del> / No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	<del>Yes</del> / No
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	<del>Yes</del> / No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	<del>Yos</del> / No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Yes / <del>No</del>
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	
	Hacking & Paterson	

b.	Is there a common buildings insurance policy?	Yes / <del>No</del> / <del>Don't Know</del>
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / <del>No</del> / <del>Don't Know</del>
с.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
	General Maintenance of Common Stair & Garden	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<del>Yes</del> / No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<del>Yes</del> / No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	<del>Yes</del> / <del>No</del>
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	¥es	Don't know	With title deeds	Lost	Cannot Answor*
(ii)	Roofing	Ne	¥es	Don't know	With title deeds	Lost	Cannot Answor*
(iii)	Central heating	Ne	¥es	Don't know	With title doods	Lost	Cannot Answor*
(iv)	NHBC	No	¥es	Don't know	With title doods	Lost	Cannot Answor*
(v)	Damp course	Nə	¥es	Don't know	With title doods	Lost	Cannot Answor*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	Ne	¥es	Don't know	With title deeds	Lost	Cannot Answor*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	l <u>s</u> ', pleas te(s):	e give de	etails of t	he work		
C.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:					¥œ	s / <del>No</del>
15.	Boundaries						
	So far as you are aware, has any boundary o last 10 years?	f your pr	operty b	een move	ed in the		/ No / <del>t know</del>
	If you have answered yes, please give details	:					

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	<del>¥es</del> / No / <del>Don't know</del>
b.	that affects your property in some other way?	<del>¥es</del> / No / <del>Don't know</del>
c.	that requires you to do any maintenance, repairs or improvements to your property?	<del>Yes</del> / No / <del>Don't know</del>
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):

Date:



ABERDEEN aberdeen\_residential@ dmhall.co.uk 01224 594172

AYR ayr@dmhall.co.uk 01292 286974

DUMFRIES dumfries@dmhall.co.uk 01387 254318

DUNDEE dundee@dmhall.co.uk 01382 873100

DUNFERMLINE dunfermline@dmhall.co.uk 01383 621262

EDINBURGH edinburghresidential@ dmhall.co.uk 0131 624 6600

ELGIN elgin@dmhall.co.uk 01343 548501

FALKIRK falkirk@dmhall.co.uk 01324 628321

GALASHIELS galashiels@dmhall.co.uk 01896 752009 GLASGOW (Residential) glasgowresidential@ dmhall.co.uk 0141 636 4141

HAMILTON hamilton@dmhall.co.uk 01698 284939

INVERNESS inverness@dmhall.co.uk 01463 241077

INVERURIE inverurie@dmhall.co.uk 01467 624393

IRVINE irvine@dmhall.co.uk 01294 311070

KIRKCALDY kirkcaldy@dmhall.co.uk 01592 598200

LIVINGSTON livingston@dmhall.co.uk 01506 490404 OBAN oban-admin@dmhall. co.uk 01631 564225

**PAISLEY** Enquiries are now dealt with at our Glasgow Hub.

PERTH perth@dmhall.co.uk 01738 562100

PETERHEAD peterhead@dmhall.co.uk 01779 470220

ST ANDREWS standrews@dmhall.co.uk 01334 844826

STIRLING stirling@dmhall.co.uk 01786 475785

